


# TN-USB-FX-01 Manual Update


## Driver Installation Note - Change “Speed and Duplex” to “100 Mbps Full Duplex”

After you successfully install the driver, the TN-USB-FX-01 will work properly for a short time. To ensure continual operation, you must change the “Speed and Duplex Property Value” as described below.

1. In Windows, navigate to the Start > Settings > Control Panel > System > Device Manager > Network Adapters menu path.

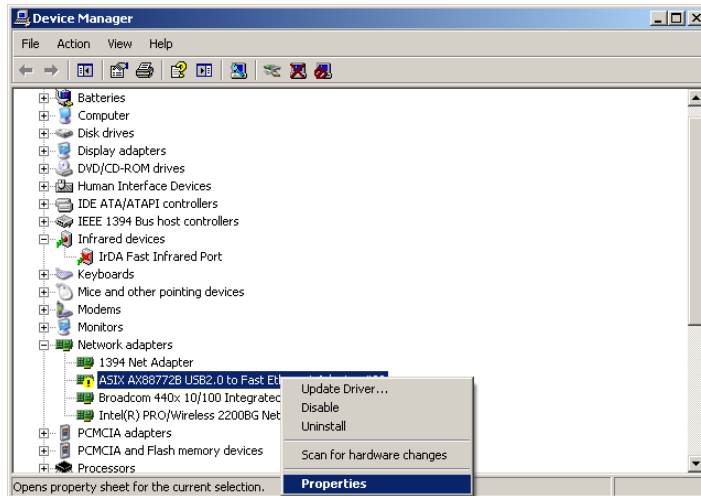

2. Select and right click the “ASIX AX88772B USB to Fast Ethernet Adapter” (the name of the chipset / manufacturer). The General tab displays the message “*Windows has stopped this device because it has reported problems. (Code 43)*”.
3. Select “Properties” and then select the “Advanced” tab.

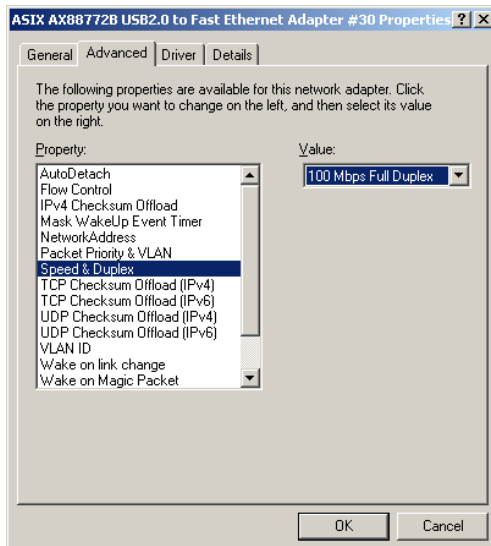

4. At the “Speed and Duplex Property Value” dropdown, change the Ethernet link speed from “Auto Negotiation” to “100 Mbps Full Duplex”.
5. Click the **OK** button.
6. Unplug and replug the TN-USB-FX-01. The device will now run properly.